



Badger Meter

Series 200

Insertion Style Flow Sensors



IMPORTANT:
This manual contains important information.
READ AND KEEP FOR REFERENCE.

Contents

| | |
|--|----|
| INTRODUCTION | 3 |
| MECHANICAL INSTALLATION | 3 |
| General | 3 |
| INSTALLATION FOR 220BR, 220SS | 3 |
| Installation Procedure | 3 |
| Alignment of Flow Sensor. | 4 |
| HOT TAP INSTALLATION FOR 225BR, 226BR, and 226SS. | 4 |
| If the Pipe is Depressurized and Drained | 5 |
| INSTALLATION INTO A PRESSURIZED PIPELINE USING MODEL HTT | 5 |
| ELECTRICAL INSTALLATION "STANDARD" SENSORS | 6 |
| ELECTRICAL INSTALLATION "IR" SENSORS | 6 |
| ELECTRICAL INSTALLATION "HIGH TEMPERATURE" SENSORS | 7 |
| ELECTRICAL INSTALLATION | 7 |
| CALIBRATION | 9 |
| Calibration Tables | 9 |
| IMPELLER ASSEMBLY AND SHAFT REPLACEMENT | 12 |
| TROUBLESHOOTING. | 12 |
| SPECIFICATIONS | 13 |

INTRODUCTION

Used in conjunction with any Badger Meter impeller flow monitor or transmitter, Badger Meter non-magnetic flow sensors provide an accurate rate of liquid flow as well as total accumulated flow. A number of sensor models are offered, which cover applications for a wide range of pipe sizes and pressure/temperature specifications.

The flow sensors generate a frequency which is proportional to flow rate. An internal preamplifier allows the pulse signal to travel up to 2000 feet without further amplification. Power to operate the sensor is provided by the flow monitor. The impeller bearing assembly, shaft and O-rings are replaceable in the field.

Badger Meter flow sensors feature a closed, six-bladed impeller design, using a proprietary, non-magnetic sensing technology. The forward-swept impeller shape provides higher, more constant torque than four-bladed impeller designs, and is less prone to fouling by water-borne debris. The forward-curved shape, coupled with the absence of magnetic drag, provides improved operation and repeatability, even at lower flow rates. As the liquid flow turns the impeller, a low impedance signal is transmitted with a frequency proportional to the flow rate.

Sensors of similar type are interchangeable, so there is no need for recalibration after servicing or replacement.

MECHANICAL INSTALLATION

General

Flow measurement accuracy for all flow measuring devices is highly dependent on proper location in the piping system. Irregular flow velocity profiles caused by valves, fittings, pipe bends, etc. can lead to inaccurate overall flow rate indications although local flow velocity measurement may be accurate. A sensor located where it can be affected by air bubbles, floating debris, or sediment may not achieve full accuracy and could be damaged. Badger Meter flow sensors are designed to operate reliably under adverse conditions, but the following recommendations should be followed to ensure maximum system accuracy:

1. Choose a location along the pipe where 10 pipe diameters upstream and 5 pipe diameters downstream of the sensor provide no flow disturbance. Pipe bends, valves, other fittings, pipe enlargements and reductions should not be present in this length of pipe.
2. The preferred location around the circumference of a horizontal pipe is on top. If trapped air or debris will interfere, then the sensor should be located further around the pipe from the top but not more than 45 degrees from top center. The sensor should never be located at the bottom of the pipe, as sediment may collect there. Locations off top center cause

the impeller friction to increase, which may affect performance at low flow rates. Any circumferential location is correct for installation in vertical pipes.

3. An insertion depth of 1-1/2 inches for pipe sizes 2.5 inches and larger is required for accurate flow rate calibration. Detailed installation instructions for various sensor mounting configurations on the following pages include methods for ensuring correct insertion depth.
4. Alignment of the sensor to ensure that impeller rotation is parallel to flow is important. Alignment instructions are also included on the following pages.

INSTALLATION FOR 220BR, 220SS

Installation Procedure

The insertion depth and alignment of the sensor assembly are critical to the accuracy of the flow measurement. The flat end of the sensor tube assembly **MUST BE INSTALLED** 1-1/2 inches from the inside wall of the pipe. In order to allow for variations in wall thickness, lining, or coatings the depth adjustment is controlled by the position of the Hex Nuts on the three threaded studs of the hex mounting adapter. The hex mounting adapter is provided with a 2 inch male NPT connection.

There are two methods of mounting these sensors in a 2.5 inch or larger pipe. One is with a 2 inch NPT threaded pipe saddle. The other is with a welded-on fitting such as a Thredolet[®], also tapped for a 2 inch NPT connection. In either case, cut a 2 inch hole through a depressurized pipe and then secure the saddle or weld-on fitting to the pipe. (For drilling into a pressurized pipe, see instructions for Series 225 and 226 sensors.) Install the 2 inch NPT adapter provided, using a thread sealant to prevent leakage. Tighten as necessary. Badger Meter insert style sensors are calibrated with the sensor inserted 1-1/2 inches into the pipe flow.

To determine the proper insertion depth, proceed as follows:

1. **Apply anti-seize thread lubricant , supplied with the sensor, to the threaded studs of the mounting adaptor.**
2. Insert the depth gauge into the mounting adapter and set it against the inside wall of the pipe as shown. Set the top of the upper adjusting nut to 3-3/4 inches as measured. Lock it in place with the bottom nut on the same stud. Repeat for the other adj. nuts.

Note: For Model 220PVS - set nuts 6.5 inches above inside wall of pipe.

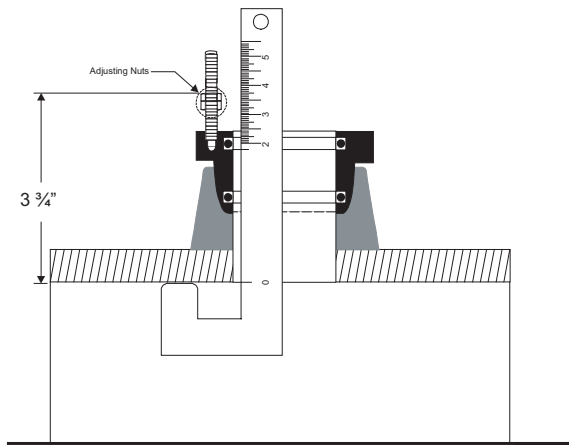


Figure 1: Installation for 220BR and 220SS

3. Clean O-rings and flow sensor sleeve, and lightly lubricate O-rings with silicone grease from the packet provided or some other acceptable lubricant. Take care not to get grease on the impeller or bearing.
4. Insert the flow sensor into the 2 inch NPT adapter so that the mounting holes in the positioning collar fit over the studs on the adapter. Lower the sensor onto the previously adjusted nuts. Install the lock nuts on top of the positioning collar and tighten. Now tighten the lower jam nuts firmly against the upper adjusting nuts to secure them for future removal of the sensor for inspection or service.

Alignment of Flow Sensor

1. Loosen positioning collar set screws with a 3/32 inch Allen wrench. Place the alignment rod through the sight holes in the flow sensor. Refer to Figure 2. Using the alignment rod as a guide, align the flow sensor so that the flow label arrow matches pipe flow direction and so that the alignment rod is exactly parallel to the pipe. This procedure aligns the impeller directly into the fluid flow.

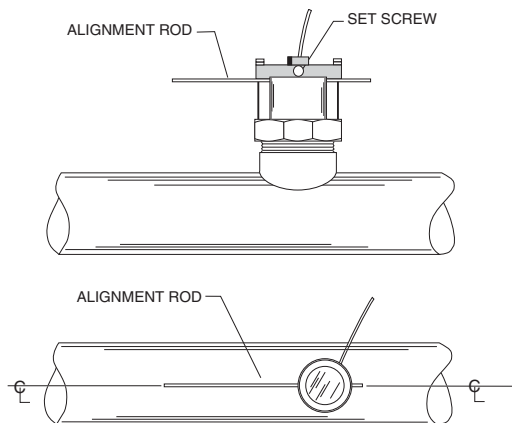


Figure 2: Alignment of Flow Sensor in 220BR and 220SS

2. As a backup to the flow arrow label, there is a small hole next to the larger sighting hole of the upstream side. With a 3/32 inch Allen wrench, tighten positioning collar set screws.
3. Double check that the sighting holes in the sleeve are parallel down the pipe and that the flow arrow label matches pipe liquid flow direction.
4. Cable routing: The positioning collar is threaded for connection of a standard 1/2 inch electrical conduit (flex cable) or a wire strain relief. Route cable as required. Be sure to leave enough flex in cable or conduit to allow future removal of sensor for service or cleaning if necessary.

HOT TAP INSTALLATION FOR 225BR, 226BR, AND 226SS

Badger Meter Series 200 hot tap style liquid flow sensors are designed for use in cases where pipelines will be in continuous service and depressurizing or draining the system for installation or service is not practical.

The Series 200 hot tap sensors are designed to be installed either in a depressurized pipe by hand or "Hot Tapped" into a pressurized pipeline. Both installation procedures are listed in this installation and operation manual. If there is the slightest possibility that the pipe could be full or pressurized, **FOLLOW THE INSTALLATION FOR PRESSURIZED PIPE.**

Refer to Figure 3 for location or identification of the various parts described in the following procedures.

The insertion depth and alignment of the sensor assembly are critical to the accuracy of the flow measurement. The flat end of the sensor tube assembly **MUST BE INSTALLED** 1-1/2 inches from the inside wall of the pipe. In order to allow for variations in wall thickness, lining or coatings the depth adjustment is controlled by the position of the hex nuts on the three threaded studs of the hex mounting adapter. The hex mounting adapter is provided with a 2 inch male NPT connection. Both gate and ball valve units are provided with 2 inch nipples for mounting onto saddles, weld-o-lets, etc.

Depth setting is accomplished by positioning the hex nuts 14-7/8 inches minus the thickness of the pipe, from the outside diameter of the pipe. For example, measure the wall thickness of the pipe from the coupon removed when the 1-7/8 inch hole was cut into the pipe. If the pipe was 1/8 inch thick, subtract 1/8 inch from 14-7/8 inch, or position the nuts 14-3/4 inch from the outside diameter of the pipe. This will allow the 16-3/8 inch sensor to protrude 1-1/2 inch into the pipe.

Apply anti-seize thread lubricant, supplied with the sensor, to the threaded studs of the mounting adaptor.

The alignment of the impeller with the flow in the pipe is accomplished by aligning the two "sight holes" at the top of the sensor tube assembly with the center line of the pipe. **Make sure the alignment is made to the pipe and not to a wall or surface near the sensor.** To adjust, loosen the two set screws in the positioning collar with a 3/32 inch Allen wrench provided in the Series 200 hot tap installation kit. Slip one end of the 1/4 inch x 18 inch steel rod (also supplied in the installation kit) through the holes in the sensor tube. Rotate the sensor tube until the rod is centered on the pipe. Ensure the flow label "Arrow" on the sensor matches the liquid flow direction. Tighten the positioning collar Allen screws to lock the sensor tube assembly in position. Note: As a backup to the flow direction arrow label on the tube assembly, there is a smaller hole located beside one of the sighting holes in the tube, to also indicate the upstream side of the tube assembly.

If the Pipe is Depressurized and Drained

1. Drill or cut a 1-7/8 inch hole in the pipe with a drill or hole saw. Note the pipe wall thickness for use in calculating sensor assembly depth. A location on the top of the pipe is best for overall performance and service life; however, any radial location on the top half of the pipe is acceptable. Allow a minimum of ten pipe diameters upstream and five downstream from the sensor of straight unobstructed pipe to allow full development of the flow profile.
2. Install either a service saddle or welded pipe fitting (2 inch female NPT) on the outside diameter of the pipe over the 1-7/8 inch hole.
3. Install the Badger Meter isolation valve and nipple onto the fitting using pipe thread sealant or Teflon® tape on all threads.
4. Install the Badger Meter hex mounting adapter onto the valve assembly. Use pipe thread sealant on the adapter. Tighten the hex adapter so that no stud is aligned with the center-line of the pipe. This could interfere with final sensor alignment. Measure depth and set the height of the nuts of the hex mounting adapter.
5. Open the bleed petcock valve on the hex adapter to relieve the pressure as the sensor tube is installed. Carefully hand insert the Badger Meter hot tap flow sensor tube into the hex mounting adapter. The sleeve should be inserted past the top two O-rings in the adapter (approx. 1 to 1-1/4 inches). **Take care not to push the tube in too far as the impeller could be damaged if it strikes the closed valve.**
6. Even if the sensor is installed with system drained, Badger Meter recommends that a HTT, hot tap insertion/removal tool be purchased for future service. This tool allows the sensor tube assembly to be removed from the pipe line without draining the entire loop where the sensor is mounted.
7. In a fully depressurized and drained pipe, the sensor tube assembly may be installed by hand. **Carefully and very slowly** open the isolation valve to relieve any pressure that may have built up. Fully open the isolation valve. Push the sensor tube into the pipe with a slight twisting motion. Guide the sensor collar holes over the three hex adapter studs until the collar rests on the nuts. Hex nuts should have been previously set to the correct height. Install the three lock nuts onto these studs at the top of the positioning collar and securely tighten.
8. Loosen the two set screws in the positioning collar with a 3/32 inch Allen wrench. Align the sensor sight holes along the pipe axis using the alignment rod provided in the installation kit supplied with the sensor. Ensure that the flow label arrow on the sensor matches the liquid flow direction inside the pipe. Tighten the positioning collar set screws. Note: As a backup to the flow label arrow, there is a small hole located beside one of the sighting holes to also indicate the upstream side of the sensor.

INSTALLATION INTO A PRESSURIZED PIPELINE USING MODEL HTT

For information on installing hot tap sensor with older 225H consult technical bulletin DID-001.

For pipe sizes 2½" and above; all Badger Meter sensors are inserted 1 1/2" from the inside wall of the pipe. The insertion depth is controlled by the position of the hex nuts on the three threaded rods. The formula below defines the distance between the top of the sensor hex mounting adaptor and the bottom of the positioning collar (the top of the hex nut). Reference Figure 3.

$$D = 16 \frac{3}{8}" - (H + \text{Pipe Wall Thickness} + 1.5")$$

Example: If sensor is installed in a 8 inch Sch 80 pipe with a pipe wall thickness of 1/2 inch and the "H" dimension is 10 inches then the calculation would be as below:

$$D = 16 \frac{3}{8}" - (10 \text{ inches} + 0.5 \text{ inches} + 1.5 \text{ inches})$$

$$D = 4 \frac{3}{8}"$$

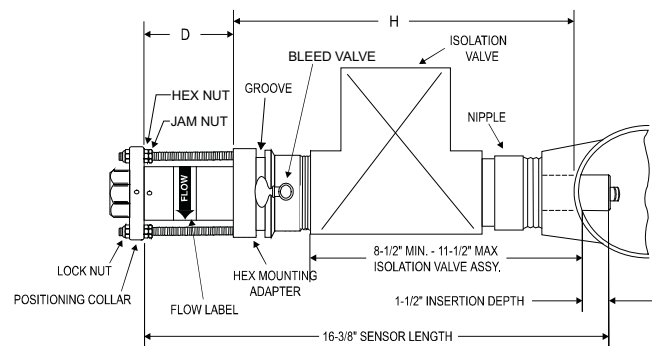


Figure 3:

1. Set one set of hex/jam nuts so that the distance between the top surface of the hex nut and the top surface of the hex mounting adaptor is equal to the "D" dimension calculated above. Then adjust the other two sets of hex/jam nuts 1-1/2 inches below the first jam nut to allow clearance for the tool top yoke.
2. Remove the tool split ring and clevis pin and slide tool bottom yoke into the groove on the sensor hex mounting adaptor and secure by replacing the clevis pin and split ring.
3. Mark sleeve 2-3/4 inches from impeller end of metal sleeve. This mark is a stopping point to insure that impeller/bearing is not damaged. Open the bleed petcock valve on the hex adapter to relieve the pressure resulting from the sensor tube insertion. Carefully hand insert the Badger Meter hot tap flow sensor sleeve assembly into the hex mounting adapter until the mark lines up with the top of the hex mounting adapter. At this point the sleeve will have been inserted past the top two "O"-rings in the adapter (approx. 1 1-1/4 inches). Take care not to push the sensor past the mark on the sleeve as the impeller could be damaged if it strikes the closed valve.
4. Fully extend tool by turning drive nut counterclockwise with a 15/16 inch socket or box wrench (not provided) until drive nut contacts tool and slide the positioning collar into the tool top yoke.
5. Rotate tool so the threaded rod with the adjusted hex/jam nuts is centered in the top yoke of hot tap tool.
6. Rotate sensor sleeve so positioning collar holes align with the threaded rods and flow direction label is in general direction making sure the positioning collar is located in the recessed area of the top yoke. Slide the top yoke of the tool over the positioning collar and secure by tightening the two thumbscrews on the top of the yoke.
7. Close the bleed petcock and slowly open the isolation valve. Slowly turn the 15/16 inch drive nut clockwise to insert the sensor tube assembly through the valve and into the pipeline. Carefully guide the three threaded studs of the hex mounting adapter through the holes of the sensor positioning collar. Carefully lower the sensor until the positioning collar contacts the hex nut preset for the correct depth adjustment. Install the three lock nuts onto the threaded rods, tightening only the lock nut on the threaded rod with the preset hex/jam nut; then, bring the two remaining lock nuts down until they just contact the positioning collar. Do not tighten at this time
8. Remove the Model HTT Insertion/Removal Tool, by loosening the two thumbscrews, removing the clevis pin and then sliding the insertion tool off the sensor. Then bring the two remaining sets of hex/jam nuts up to the underside of the positioning collar, and tighten.
9. Align the sensor by first loosening the two set screws in the side of positioning collar with a 3/32 inch Allen wrench. Then align the sensor sight holes along the pipe axis using the alignment rod provided in the sensor installation kit. Ensure that the flow label arrow on the sensor matches the liquid flow direction inside the pipe. Tighten the positioning collar set screws. Note: As a backup to the flow label arrow, there is a small hole located beside the sight hole on the upstream side of the sensor.

ELECTRICAL INSTALLATION "STANDARD" SENSORS

1. The metal collar on the top of the 220 sensors or an optional conduit cap on the Series 250 sensors will accept 1/2 inch threaded conduit fittings.
2. Route the cable from the sensor to a Badger Meter flow monitor/transmitter. The cable may be extended up to 2000 feet, using 2-conductor shielded 20 AWG or larger stranded copper wire. Be sure to leave enough flexibility in the cable or conduit to allow for future service of sensor, if necessary.
3. When connecting to a Badger Meter flow monitor/transmitter, locate the section of terminal strip on the monitor labeled "**SENSOR INPUT**" or "**SENSOR**". Connect the red wire to "**IN**", "**SIGNAL(+)**" or "**SIGNAL**" terminal and the black wire to "**GND**", "**SIGNAL(-)**", or "**COM**" terminal and the shield drain wire (if applicable) to "**SLD**".
4. When interfacing with other equipment, consult manufacturer for input designations. The signal wave forms and power requirements are as shown in the specifications section. Refer to Technical Bulletin DTB-058 at www.badgermeter.com.

ELECTRICAL INSTALLATION "IR" SENSORS

The sensor leads are supplied with watertight caps over the ends. See Application Note DAB-031 and Technical Bulletin DID-003 at www.badgermeter.com.

1. DO **NOT** remove the plastic caps from the sensor leads until ready to splice.
2. Use a **twisted pair** cable suitable for direct burial to connect the sensor to the transmitter, monitor, or controller. Multi-pair telecommunication cable or direct burial cables may be used.
3. Make a water tight splice. Two part epoxy type waterproof kits are recommended. Be sure the epoxy seals the ends of the cable jacket.
4. Make sure the epoxy is hardened before inverting the splice or dropping it in standing water.

5. DO **NOT** make an underground splice unless absolutely necessary.
6. Route the cable from the sensor to a Badger Meter flow monitor/transmitter. The cable may be extended up to 2000 feet, using 2-conductor shielded 20 AWG or larger stranded copper wire with appropriate ratings. Be sure to leave enough flexibility in the cable or conduit to allow for future service of sensor, if necessary.
7. When connecting to a Badger Meter flow monitor/transmitter, locate the section of terminal strip on the monitor labeled **"SENSOR INPUT"** or **"SENSOR"**. Connect the red wire to **"IN"**, **"SIGNAL(+)"** or **"SIGNAL"** terminal and the black wire to **"GND"**, **"SIGNAL(-)"**, or **"COM"** terminal and the shield drain wire (if applicable) to **"SLD"**.
8. When interfacing with other equipment, the signal wave forms and power requirements are as shown in the specifications section. Refer to technical bulletin DTB-058 at www.badgermeter.com.

ELECTRICAL INSTALLATION "HIGH TEMPERATURE" SENSORS

1. Route a cable from the sensor to a Badger Meter flow monitor/transmitter. The cable may be run up to 2000 feet, using 2-conductor shielded 20 AWG or larger stranded copper wire. Be sure to leave enough flexibility in the cable or conduit to allow for future service of sensor, if necessary.
2. Connect to cable inside sensor electronic housing on Series 220 sensors or attach to the sensor cable on the Series 225/226 and connect with standard wire nuts.
3. When connecting to a Badger Meter flow monitor or transmitter, locate the section of terminal strip on the monitor labeled **"SENSOR INPUT"** or **"SENSOR"**. Connect the red wire to **"IN"**, **"SIGNAL(+)"** or **"SIGNAL"** terminal and the black wire to **"GND"**, **"SIGNAL(-)"**, or **"COM"** terminal and the shield drain wire (if applicable) to **"SLD"**.
4. When interfacing with other equipment, the signal wave forms and power requirements are as shown in the specifications section.

ELECTRICAL INSTALLATION

The Series 200 sensor is approved, as an entity, as intrinsically safe when installed in conformance with Badger Meter installation drawing 06-480-002 as specified on the blue label identifying an intrinsically safe sensor.

Entity approval implies that only the sensor is approved as intrinsically safe. Unless power supplies, equipment, and instruments connected to the sensor are each rated either explosion-proof or intrinsically safe, these devices cannot be installed in a hazardous area. The referenced installation drawing shows such apparatus located in a non-hazardous location. Proper interfacing between the hazardous and non-hazardous areas must be provided. It is of absolute importance that this interface be constructed and that all wiring be performed by qualified contractors. To ensure the intrinsic safety of the installation, the connection of the intrinsically safe sensor to instruments and or power supplies must take place using an approved intrinsically safe barrier located in a non-hazardous area. These barriers, listed below, are readily available from various suppliers.

| Manufacturer: | Barrier: |
|-----------------------------|---------------------|
| Crouse-Hinds Spec 504 | Cat No.SB19140M0715 |
| Measurement Technology Ltd. | MTL 715+ 15 V |
| R Stahl Intrinspak | 9001/1-158-150-10 |


Series 200 Flow Sensors

THIS DOCUMENT CONTAINS INFORMATION PROPRIETARY TO DATA INDUSTRIAL. NEITHER RELEASED FOR PRODUCTION NOR FOR SALE. ANY REPRODUCTION, DISSEMINATION, OR USE OF THIS INFORMATION WITHOUT WRITTEN AUTHORIZATION OF DATA INDUSTRIAL IS PROHIBITED.

| REVISIONS | | | |
|-----------|-------------------|----------|------|
| REV | DESCRIPTION | DATE | BY |
| A | RELEASED ECD 3250 | | |
| B | ECD 3263 | 7-6-94 | |
| C | ECD 3292 | 12/27/94 | |
| D | ECD 3649 | 11/10/98 | R.G. |

HAZARDOUS LOCATION

NON-HAZARDOUS LOCATION

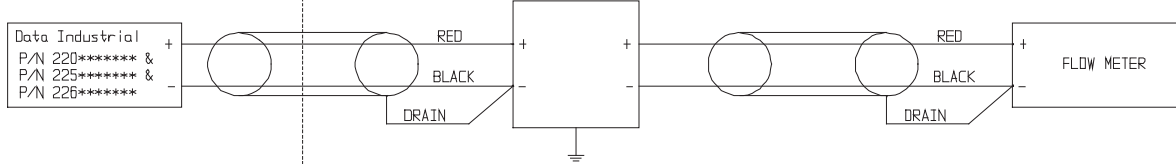

USABLE IN HAZARDOUS LOCATIONS
 CLASS I, DIVISION 1,
 CLASS II, DIVISION 1,
 CLASS III, DIVISION 1,
 GROUPS A, B, C, D, E, F, G

CSA CERTIFIED
 INTRINSIC SAFETY BARRIER
 CROUSE-HINDS, SPEC 504, CAT. NO. SB19140M0715
 MEASUREMENT TECHNOLOGY LTD. MTL 715+ 15 V,
 R. STAHL INTRINSPAK 9001/01-158-150-10

NOTES:

1. INSTALLATION SHALL BE IN ACCORD WITH THE INTRINSIC SAFETY BARRIER MANUFACTURERS INSTRUCTIONS AND CANADIAN ELECTRICAL CODE
2. NO CHANGES TO THIS DRAWING WITHOUT PRIOR WRITTEN AUTHORIZATION FROM CSA

DO NOT SCALE DRAWING

| | | | | | |
|----------------------|------------------|--|--|-----------------------|----------|
| DRAWN BILL HEELAN | DATE 04/20/94 | | 11 INDUSTRIAL DRIVE WATTAUGSETT, MA 02739 (508)-758-6390 | | |
| CHECKED | DATE | | PROJECT CSA CERTIFIED SENSORS | | |
| APPROVAL | DATE | PART INSTALLATION DRAWING FOR CSA CERTIFIED 220CP, 220PV, 220BR*, 220SS*, 225*, & 226*-SENSORS | | | |
| FNRC APPROVAL | DATE | SIZE B | FORM NO. | DWG NO. 06-480-001 | REV D |
| | | SCALE NONE | 06480001D.PRT | SHEET 2 of 2 | |

CALIBRATION

Badger Meter sensors use unique K and Offset numbers for calibration. These numbers are derived from calibration runs using NIST traceable instruments. Using both a K and an Offset number provides higher accuracy than using a K (pulse/gal) factor alone. K and Offset numbers for each tee configuration are listed in the following tables.

Calibration Tables

The table on pages 12 and 13 provides calibration and operation data for most scheduled pipe sizes from 3 inches through 18 inches. For tee-mounted sensors, see either Metal Tee (Manual Number 872021), or (Plastic Tee Manual Number 872022).

Description of Column Information for Pipe Sizes 3 inches through 36 inches

| | |
|-----------------|--|
| Column 1 | Nominal Pipe Size |
| Column 2 | Pipe O.D. as defined by ASA B36.10 and other standards |
| Column 3 | Pipe I.D. as defined by ASA B36.10 and other standards |
| Columns 4 and 5 | The K value and Offset that should be used in our frequency equation: |
| | $\text{Freq} = \frac{\text{Gpm}}{K} - \text{Offset}$ |
| | This equation describes the frequency of the output signal of all Badger Meter flow sensors. By substituting the appropriate K and Offset values from the table, the sensor's output frequency can be calculated for each pipe size. This information is required when calibrating an output board or when using the raw sensor data as direct output to interface with a device that is not a Badger Meter product. |

| | |
|----------|--|
| Column 6 | <p>This column indicates the suggested flow range of sensors in each pipe size. Badger Meter sensors will operate both above and below the indicated flow rates. However, good design practice dictates the use of this range for best performance.</p> <p>Sensors should be sized for flow rather than pipe size. To prevent disturbances to the flow profile, always connect the sensor tee to the pipe nipples measuring at least ten pipe diameters in length on the downstream (delivery) side before making the transition in pipe size.</p> |
|----------|--|

Series 200 Flow Sensors

| Column 1 | Column 2 | Column 3 | Column 4 | Column 5 | Column 6 |
|----------------------|-----------|-----------|----------|----------|---------------------------------|
| Pipe Size | Pipe O.D. | Pipe I.D. | K | Offset | Suggested Operating Range (GPM) |
| 3 inch Sch 10S | 3.500" | 3.260" | 5.009 | .090 | 12-400 |
| Std. Wt., Sch 40 | 3.5" | 3.068" | 4.362 | .063 | 12-400 |
| Extra Strong, Sch 80 | 3.5" | 2.900" | 3.858 | .043 | 12-400 |
| PVC Class 125 | 3.5" | 3.284" | 5.094 | .093 | 12-400 |
| PVC Class 160 | 3.5" | 3.230" | 4.902 | .085 | 12-400 |
| PVC Class 200 | 3.5" | 3.166" | 4.682 | .076 | 12-400 |
| 4 inch Sch 10S | 4.5" | 4.260" | 9.597 | .241 | 20-600 |
| Std. Wt., Sch 40 | 4.5" | 4.026" | 8.34 | .229 | 20-600 |
| Extra Strong, Sch 80 | 4.5" | 3.826" | 7.354 | .188 | 20-600 |
| PVC Class 125 | 4.5" | 4.224" | 9.396 | .240 | 20-600 |
| PVC Class 160 | 4.5" | 4.154" | 9.013 | .240 | 20-600 |
| PVC Class 200 | 4.5" | 4.072" | 8.578 | .239 | 20-600 |
| 5 inch Sch 10S | 5.563" | 5.295" | 16.305 | .250 | 30-900 |
| Std. Wt., Sch 40 | 5.50" | 5.047" | 14.674 | .248 | 30-900 |
| Extra Strong, Sch 80 | 5.50" | 4.813" | 13.165 | .246 | 30-900 |
| 6 inch Sch 10S | 6.625" | 6.357" | 24.089 | .260 | 50-1,500 |
| Std. Wt., Sch 40 | 6.5" | 6.065" | 21.574 | .257 | 50-1,500 |
| Extra Strong, Sch 80 | 6.5" | 5.761" | 19.457 | .254 | 50-1,500 |
| PVC Class 125 | 6.625" | 6.217" | 22.853 | .258 | 50-1,500 |
| PVC Class 160 | 6.625" | 6.115" | 21.968 | .257 | 50-1,500 |
| PVC Class 200 | 6.625" | 5.993" | 21.068 | .256 | 50-1,500 |
| 8 inch Sch 10S | 8.625" | 8.329" | 43.914 | 0.286 | 80-2,500 |
| Sch 20 | 8.625" | 8.125" | 41.653 | 0.283 | 80-2,500 |
| Sch 30 | 8.625" | 8.071" | 41.063 | 0.283 | 80-2,500 |
| Std. Wt., Sch 40 | 8.625" | 7.981" | 40.086 | 0.281 | 80-2,500 |
| Sch 60 | 8.625" | 7.813" | 38.288 | 0.279 | 80-2,500 |
| Extra Strong, Sch 80 | 8.625" | 7.625" | 36.315 | 0.276 | 80-2,500 |
| PVC Class 125 | 8.625" | 8.095" | 41.324 | 0.283 | 80-2,500 |
| PVC Class 160 | 8.625" | 7.961" | 39.869 | 0.281 | 80-2,500 |
| PVC Class 200 | 8.625" | 7.805" | 38.203 | 0.279 | 80-2,500 |
| 10 inch Sch 10S | 10.75" | 10.420" | 70.195 | 0.321 | 125-4,000 |
| Sch 20 | 10.75" | 10.250" | 67.668 | 0.318 | 125-4,000 |
| Sch 30 | 10.75" | 10.136" | 66.069 | 0.316 | 125-4,000 |
| Sch 40, Std.Wt. | 10.75" | 10.020" | 64.532 | 0.314 | 125-4,000 |
| Extra Strong, Sch 60 | 10.75" | 9.750" | 61.016 | 0.309 | 125-4,000 |
| Sch 80 | 10.75" | 9.564" | 58.644 | 0.306 | 125-4,000 |
| PVC Class 125 | 10.75" | 10.088" | 65.431 | 0.315 | 125-4,000 |
| PVC Class 160 | 10.75" | 9.924" | 63.272 | 0.312 | 125-4,000 |
| PVC Class 200 | 10.75" | 9.728" | 60.733 | 0.309 | 125-4,000 |
| 12 inch Sch 10S | 12.75" | 12.390" | 104.636 | 0.367 | 175-5,000 |
| Sch 20 | 12.75" | 12.250" | 102.553 | 0.364 | 175-5,000 |
| Sch 30 | 12.75" | 12.090" | 99.347 | 0.36 | 175-5,000 |
| Std. Wt., Sch 40S | 12.75" | 12.000" | 97.576 | 0.358 | 175-5,000 |
| Sch 40 | 12.75" | 11.938" | 96.369 | 0.356 | 175-5,000 |
| Sch 60 | 12.75" | 11.625" | 90.441 | 0.348 | 175-5,000 |
| Extra Strong | 12.75" | 11.750" | 92.775 | 0.351 | 175-5,000 |
| Sch 80 | 12.74" | 11.376" | 85.922 | 0.342 | 175-5,000 |
| PVC Class 125 | 12.75" | 11.966" | 96.912 | 0.357 | 175-5,000 |
| PVC Class 160 | 12.75" | 11.770" | 93.152 | 0.352 | 175-5,000 |
| PVC Class 200 | 12.75" | 11.538" | 88.842 | 0.346 | 175-5,000 |

Calibration Table for Pipe Sizes 3 Inches Through 36 Inches

Continued on Next Page

| Column 1 | Column 2 | Column 3 | Column 4 | Column 5 | Column 6 |
|--------------------------|-----------|-----------|----------|----------|---------------------------------|
| Pipe Size | Pipe O.D. | Pipe I.D. | K Value | Offset | Suggested Operating Range (GPM) |
| 14 inch Sch 10S | 14.00" | 13.500" | 122.307 | 0.391 | 200-6,000 |
| Sch 20 | 14.00" | 13.375" | 120.216 | 0.388 | 200-6,000 |
| Std. Wt., Sch 30 | 14.00" | 13.250" | 118.151 | 0.385 | 200-6,000 |
| Sch 40 | 14.00" | 13.124" | 116.096 | 0.382 | 200-6,000 |
| Sch 60 | 14.00" | 12.814" | 111.148 | 0.376 | 200-6,000 |
| Extra Strong | 14.00" | 13.00" | 114.098 | 0.33 | 200-6,000 |
| Sch 80 | 14.00" | 12.50" | 106.299 | 0.369 | 200-6,000 |
| 16 inch Sch 10S | 16.00" | 15.500" | 159.243 | 0.44 | 300-9,000 |
| Sch 20 | 16.00" | 15.375" | 156.742 | 0.436 | 300-9,000 |
| Std. Wt., Sch 30 | 16.00" | 15.250" | 154.267 | 0.433 | 300-9,000 |
| Sch 60 | 16.00" | 14.688" | 143.456 | 0.419 | 300-9,000 |
| Extra Strong, Sch 40 | 16.00" | 15.000" | 149.394 | 0.427 | 300-9,000 |
| Sch 80 | 16.00" | 14.314" | 136.548 | 0.41 | 300-9,000 |
| 18 inch Sch 10S | 18.00" | 17.500" | 202.739 | 0.498 | 350-10,000 |
| Sch 20 | 18.00" | 17.375" | 199.828 | 0.494 | 350-10,000 |
| Sch 30 | 18.00" | 17.124" | 194.061 | 0.486 | 350-10,000 |
| Std. Wt. | 18.00" | 17.250" | 196.943 | 0.49 | 350-10,000 |
| Sch 40 | 18.00" | 16.876" | 188.464 | 0.479 | 350-10,000 |
| Sch 60 | 18.00" | 16.500" | 180.171 | 0.469 | 350-10,000 |
| Extra Strong | 18.00" | 17.000" | 191.25 | 0.482 | 350-10,000 |
| Sch 80 | 18.00" | 16.126" | 172.152 | 0.457 | 350-10,000 |
| 20 inch Std. Wt., Sch 20 | 20.00" | 19.25" | 246.179 | 0.555 | 400-12,000 |
| Sch 40 | 20.00" | 18.812" | 234.836 | 0.540 | 400-12,000 |
| Extra Strong, Sch 30 | 20.00" | 19.000" | 239.666 | 0.547 | 400-12,000 |
| Sch 80 | 20.00" | 17.938" | 213.14 | 0.511 | 400-12,000 |
| 22 inch Std. Wt., Sch 20 | 22.00" | 21.25" | 301.975 | 0.621 | 500-15,000 |
| Extra Strong, Sch 30 | 22.00" | 21.00" | 294.642 | 0.616 | 500-15,000 |
| Sch 80 | 22.00" | 19.75" | 259.513 | 0.573 | 500-15,000 |
| 24 inch Std. Wt., Sch 20 | 24.00" | 23.25" | 364.331 | 0.666 | 600-18,000 |
| Extra Strong | 24.00" | 23.00" | 356.178 | 0.660 | 600-18,000 |
| Sch 40 | 24.00" | 22.624" | 344.109 | 0.652 | 600-18,000 |
| Sch 80 | 24.00" | 21.562" | 311.271 | 0.628 | 600-18,000 |
| 26 inch Sch 10 | 26.00" | 25.376" | 437.809 | 0.719 | 700-21,000 |
| Std. Wt. | 26.00" | 25.25" | 433.247 | 0.716 | 700-21,000 |
| Sch 20, Extra Strong | 26.00" | 25.00" | 424.274 | 0.709 | 700-21,000 |
| 28 inch Sch 10 | 28.00" | 27.376" | 513.698 | 0.774 | 900-23,000 |
| Std. Wt. | 28.00" | 27.25" | 508.723 | 0.770 | 900-23,000 |
| Extra Strong, Sch 20 | 28.00" | 27.00" | 498.930 | 0.763 | 900-23,000 |
| 30 inch Sch 10 | 30.00" | 29.376" | 596.147 | 0.833 | 1,000-30,000 |
| Std. Wt. | 30.00" | 29.25" | 590.759 | 0.829 | 1,000-30,000 |
| Sch 20, Extra Strong | 30.00" | 29.00" | 580.146 | 0.822 | 1,000-30,000 |
| 32 inch Sch 10 | 32.00" | 31.376" | 685.156 | 0.897 | 1,200-35,000 |
| Std. Wt. | 32.00" | 31.25" | 679.355 | 0.893 | 1,200-35,000 |
| Sch 20, Extra Strong | 32.00" | 31.00" | 667.922 | 0.885 | 1,200-35,000 |
| Sch 40 | 32.00" | 30.624" | 650.919 | 0.873 | 1,200-35,000 |
| 34 inch Sch 10 | 34.00" | 33.312" | 777.566 | 0.964 | 1,300-40,000 |
| Std. Wt. | 34.00" | 33.25" | 774.511 | 0.962 | 1,300-40,000 |
| Extra Strong, Sch 20 | 34.00" | 33.00" | 762.258 | 0.953 | 1,300-40,000 |
| Sch 40 | 34.00" | 32.624" | 744.022 | 0.940 | 1,300-40,000 |
| 36 inch Sch 10 | 36.00" | 35.376" | 882.855 | 1.040 | 1,500-45,000 |
| Std. Wt. | 36.00" | 35.25" | 876.227 | 1.035 | 1,500-45,000 |
| Sch 20, Extra Strong | 36.00" | 35.00" | 863.154 | 1.025 | 1,500-45,000 |
| Sch 40 | 36.00" | 34.50" | 837.315 | 1.007 | 1,500-45,000 |

Calibration Table for Pipe Sizes 3 Inches Through 36 Inches

IMPELLER ASSEMBLY AND SHAFT REPLACEMENT

If you are replacing an existing Badger Meter sensor and have already calibrated your flow monitor/transmitter, no calibration changes are necessary. For installation of a new flow monitor or for relocation of a sensor in a new pipe size, please refer to the calibration instructions in flow monitor manual.

1. Depressurize pipe from which sensor is to be removed. If the sensor is one of the Series 225/IR225 or 226/IR226, consult the installation section on hot tap sensors.

NEVER disturb the securing lock nuts with pipe under pressure without hot tap insertion tool Model HTT installed.

2. Remove the three lock nuts that secure the positioning collar to the threaded rods of metal sensor.

NOTE: Before removing lock nuts, record the dimension from top of 2 inch NPT adapter to the bottom of the positioning collar. This dimension will be required later to reinstall.

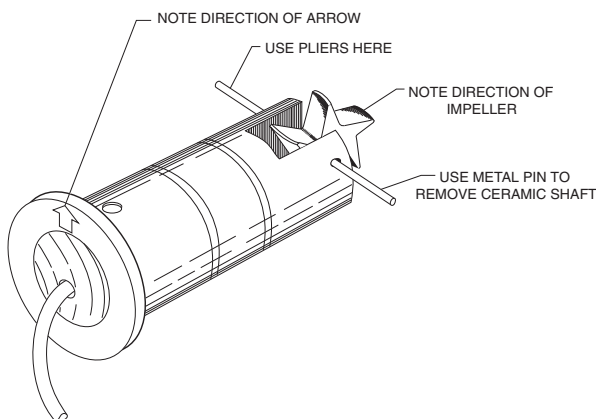


Figure 4: Impeller Assembly and Shaft Replacement

3. Remove the sensor from the hex adapter or the tee.
4. Note the impeller blade orientation relative to flow arrows and the alignment hole in metal sensors beside one of the sighting holes. In order to maintain proper calibration, the impeller will have to be reinstalled in the same manner with the impeller blades pointing toward the small alignment hole, and into the flow direction as indicated by the flow arrows.
5. To remove the old impeller blade assembly, push the old shaft out of the sleeve with the new shaft (or small diameter rod) just far enough to grab the end with a pair of pliers and pull the shaft completely out. The impeller assembly will now be free and will drop out.

6. Inspect the shaft and bearings for wear, and replace as necessary.
7. Refer to figure 4. To reinstall, position the impeller in the cavity oriented as in step 4 so that the impeller blades point into the flow direction and toward the small alignment hole located beside one of the sighting holes on metal sensors.
8. Carefully push the shaft through the sleeve and impeller taking care not to damage the bearings. Make sure that the shaft is inserted far enough so that it clears the sleeve on each side of the impeller housing.

NOTE: If shaft is not carefully installed, the bearing can be deformed preventing free rotation.

9. Inspect the O-rings for damage and replace as necessary. Clean the O-rings and the sleeve and relubricate with silicone grease from the packet provided or some other acceptable lubricant.
10. Install the sensor into the 2 inch NPT adapter or tee so that alignment hole is facing upstream and flow arrows point in the direction of the actual flow. Since the positioning collar was not loosened during this operation, the studs should all line up perfectly when the sighting holes are parallel to pipe. If this has been accidentally loosened, please refer to the installation instructions for the alignment of the flow sensor unit.
11. Install and tighten the nuts.
12. For metal sensors, double check that the distance from the top of the 2 inch NPT adapter to the bottom of the positioning collar equals the dimension as measured in step 2, and holes in sleeve sight exactly down the pipe, the arrows point in direction of flow and alignment holes located beside one sighting hole is pointing towards the source. If not, refer to *installation* section in this manual.
13. This completes the replacement procedure. The system may now be repressurized and tested.

TROUBLESHOOTING

1. If the voltage at the sensor input is less than 7 VDC in a no flow situation, disconnect the sensor from the barrier strip and measure the voltage at the sensor input terminals of the barrier strip again. It should be between 8 VDC and 20 VDC. If the voltage at the sensor input is still below 7 VDC or 3 VDC, the problem may be with the monitor (hardware or programming).

2. If you suspect that the sensor is bad, you can test the monitor circuitry by connecting a piece of wire to one of the sensor input terminals and tap the other side of the wire to the other sensor input terminal. Shorting across the sensor input terminals ON and OFF repeatedly allows the display to respond by trying to calculate a flow rate for the frequency of your shorting action. If the display does not show a change from 0.00, it indicates a problem with the monitor.
3. If the monitor tests ok and there are any splices in the cable, break the sensor cable at the splice closest to the sensor and retry the shorting test in step 2.
4. If the cable tests ok, drain the pipe line, verify the pressure is off, remove top lock nuts holding the sensor electronics. Spin the impeller by hand. If flows are noted on the display, and impeller spins freely then the flow rates may have been below our design minimums or the line was full of air. Try again. If the sensor fails to respond then replace sensor.

SPECIFICATIONS

Wetted Materials for all sensors

- See Technical Brief for material specifics

Sensor Sleeve and Hex Adapter for 220BR, 225BR, and 226BR

- Sleeve: admiralty brass, UNS C44300; hex adapter: valve bronze, UNS C83600

Sensor Sleeve and Hex Adapter for 220SS and 226SS

- Series 300 stainless steel

Temperature Ratings

- Standard version: 221°F (105°C) continuous service
- High temperature version: 285°F (140.6°C) continuous service; 305°F (150°C) peak temperature (limited duration)

Pressure Ratings

| | At 100°F | At 300°F |
|-------|----------|----------|
| 220SS | 400 psi | 325 psi |
| 220B | 400 psi | 325 psi |
| 225B | 300 psi | 210 psi |
| 226B | 400 psi | 250 psi |
| 226SS | 400 psi | 300 psi |

Recommended Design Flow Range

- 0.5 to 30 ft/sec
- Initial detection below 0.3 ft/sec

Accuracy

- $\pm 1.0\%$ of full scale over recommended design flow range

Repeatability

- $\pm 0.3\%$ of full scale over recommended design flow range

Linearity

- $\pm 0.2\%$ of full scale over recommended design flow range

Transducer Excitation

- Quiescent current 600uA@8VDC to 35VDC max.
- Quiescent voltage (V_{high})
Supply Voltage $-(600uA * \text{Supply impedance})$
- ON State (V_{Low}) Max. 1.2VDC@40mA current limit (15ohm+0.7VDC)

Output Frequency

- 3.2 Hz to 200 Hz

Output Pulse Width

- 5 msec $\pm 25\%$

Electrical Cable for Standard Sensor Electronics

- 20 feet of 2-conductor 20 AWG shielded U.L. type PTLT wire provided for connection to display or analog transmitter unit. Rated to 105°C. May be extended to a maximum of 2000 feet with similar cable and insulation appropriate for application.

Electrical Cable for IR Sensor Electronics

- 48 inches of U.L. Style 116666 copper solid AWG 18 wire with direct burial insulation. Rated to 105°C.

This page intentionally left blank.

This page intentionally left blank.



Data Industrial is a registered trademark of Badger Meter, Inc. Other trademarks appearing in this document are the property of their respective entities.

Due to continuous research, product improvements and enhancements, Badger Meter reserves the right to change product or system specifications without notice, except to the extent an outstanding contractual obligation exists. © 2012 Badger Meter, Inc. All rights reserved.

www.badgermeter.com

The Americas | Badger Meter | 4545 West Brown Deer Rd | PO Box 245036 | Milwaukee, WI 53224-9536 | 800-876-3837 | 414-355-0400

México | Badger Meter de las Americas, S.A. de C.V. | Pedro Luis Ogazón N°32 | Esq. Angelina N°24 | Colonia Guadalupe Inn | CP 01050 | México, DF | México | +52-55-5662-0882

Europe, Middle East and Africa | Badger Meter Europa GmbH | Nurtinger Str 76 | 72639 Neuffen | Germany | +49-7025-9208-0

Czech Republic | Badger Meter Czech Republic s.r.o. | Maříkova 2082/26 | 621 00 Brno, Czech Republic | +420-5-41420411

Slovakia | Badger Meter Slovakia s.r.o. | Racianska 109/B | 831 02 Bratislava, Slovakia | +421-2-44 63 83 01

Asia Pacific | Badger Meter | 80 Marine Parade Rd | 21-04 Parkway Parade | Singapore 449269 | +65-63464836

China | Badger Meter | Rm 501, N° 11 Longyue Apartment | N° 180 Longjin Rd, Jiuting Songjiang District | Shanghai, China | 201615 | +86-21-5763 5412